

REPAIR QUANTITY TABLE QUANTITIES BENT 5 ESTIMATE ACTUAL SHOTCRETE REPAIRS VOLUME VOLUME CAP (VERTICAL FACE) 1.0 0.3 CAP (HORIZONTAL FACE) 0.0 0.00 0.0 0.00 COLUMN (HORIZONTAL FACE) 0.0 CONCRETE REPAIR 0.0 LN. FT LN. FT EPOXY RESIN INJECTION CAP 3.0 COLUMN 0.0 EPOXY COATING 205.0

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1"BEHIND REBAR AND MIN.1"CL TO SAWCUT. SEE REPAIR DETAILS.

NOTES:

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE INSPECTOR OR ENGINEER THE CONTRACTOR SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE.

CONTRACTOR SHALL SAW CUT TO A NOMINAL DEPTH OF $1/\!\!/_2{''}$ BUT REINFORCING STEEL SHALL NOT BE DAMAGED.

CONTRACTOR SHALL REMOVE SURFACE CONCRETE TO VERIFY THAT SAWCUT DEPTH WILL NOT DAMAGE EXISTING REINFORCING STEEL.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.


FOR SHOTCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR EPOXY RESIN INJECTION, SEE SPECIAL PROVISIONS.

FOR REPAIR DETAILS, SEE TYPICAL CAP AND COLUMN REPAIR DETAILS SHEET.

THE CONTRACTOR SHALL EPOXY COAT PAINT THE TOP SURFACE OF BENT CAPS AFTER ALL BEARING REPAIRS ARE COMPLETED, AS A FINAL FINISH.

FOR EPOXY COATING AND DEBRIS REMOVAL, SEE SPECIAL PROVISIONS.

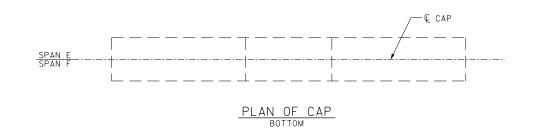

CONCRETE REPAIRS

SHOTCRETE REPAIR

ERI EPOXY RESIN INJECTION

DocuSigned by:

FAXOUR OF THE PROPERTY OF THE

PROJECT NO. _____ I-5763 _____ RANDOLPH ____ COUNTY BRIDGE NO. _____ 235

STATE OF NORTH CAROLINA
DEPARTMENT OF TRANSPORTATION
RALEIGH

SUBSTRUCTURE

BENT 5 NBL

18-NOV-2015 08:50
Z:\TIPProjects-I\I5763\Structures\I-5763 FinalDrawings\DGN\405_025_I5763_SMU_S33_B5.DGN
fasefaia